Technical Assistance: 106 Replaced axle set of calipers – Bleeding problem.

Symptoms: Fitted or replaced both front or both rear calipers and now can't get a pedal.

Cause: Some calipers have the inlet feed in the middle of the body, pointing to the centre of the vehicle. This can lead to the calipers being fitted on the wrong sides. If this happens, the bleed nipples are at the bottom instead of the top.

Solution: Swap the calipers to the correct hands with bleed nipples at the top. Or you may prefer to turn the vehicle upside down when bleeding the calipers.

